

IMPROVED LOCK NUT IN GLYCOL PUMPS

Lock Nuts Changed from 1140 to 1140X

This product update is to inform you that we are changing the 1140 lock nut to the 1140X.

The 1140X is a reliable off-the-shelf alternative to the 1140 custom lock nut. We've made this change to resolve a concern where the threads on the piston rod of 45020 PV and 20020 SC glycol pumps have been damaged during routine maintenance.




Old Part Number: 1140

Will remain in Repair Kits until 4/1/2021
Requires 1-1/4" Socket



New Part Number: 1140X

Now Standard in 45020 PV and 20020 PV Glycol Pumps
Standard in Repair Kits after 4/1/2021
Requires a larger 1-5/16" Socket

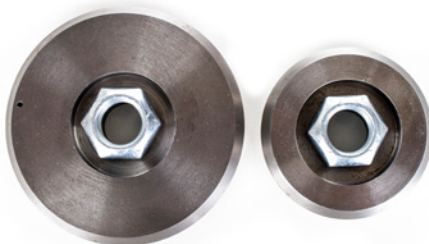

1147 Piston

1508 Piston

Other Affected Parts: 1147 and 1508 Pistons

All 1147 (GAJ Models) and 1508 (GAK Models) produced after 9/2019 have been reworked to accommodate the larger 1-5/16" socket.

Note: If the pistons in your pump have not been replaced since 9/2019 and you need to install the new 1140X lock nut, it will require the installation of the new (reworked) piston.

These products will be affected:

- GAJ1, GAJV, GAJHSN, GAJAF (Produced after 9/2019)
- RJL1-V, RJL1-HSN, RJL1-AF (Beginning 4/1/2021)
- GAK1, GAKV, GAKHSN, GAKAF (Produced after 1/2020)
- RJN1-V, RJN1-HSN, RJN-AF (Beginning 4/1/2021)

Please contact your local authorized distributor or Kimray store with any questions or concerns regarding this product update.